

Work Order ID 70723

Monday, June 13, 2011 3:24:37 PM



Page 1

Item ID: D3852-042

Accept



Setup Start



Revision ID:

Stop



Item Name: Rib Assembly

Start Date: 6/13/2011 Start Qty: 2.00

Required Date: 6/20/2011 Req'd Qty: 2.00



Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date: 6-13-11

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D3852

Rev A

100

0.00



Large Fab

Large Fab

Memo

0.00

Large Fab

1- pick D3166-3 to cut D3852-2 rib (RH) as per dwg D3852 using DT9440 jig

2- drill hole (3/16") in D3852-2 using DT9439 jig and open to finish size as per dwg D3852

3- c'sink hole as per dwg

4- remove identification markings

5- deburr

6- weld D3759-1 bushing as per dwg D3852

A/R ER316 S.S. Rod Batch: 115928

7- grind bushing weld flush as per dwg dwg D3852

8- deburr hole if necessary

SAD 11-07-04

611.07.05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 70723

Monday, June 13, 2011 3:24:38 PM



Page 2

Item ID:	D3852-042	Accept		Setup	Start	
Revision ID:					Stop	
Item Name:	Rib Assembly					
Start Date:	6/13/2011	Start Qty: 2.00		Cust Item ID:		
Required Date:	6/20/2011	Req'd Qty: 2.00		Customer:		
Reference:						

Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start	
	QC:	Date:	SPC (Y/N):	Date:		Stop	

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00		84107106					
140 QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00		84107106		(X6) -OK			
150 Packaging Packaging	Identify as per dwg & Stock Location: B/c Memo	0.00 0.00							PC11.07.06

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 70723

Monday, June 13, 2011 3:24:38 PM



Page 3

Item ID: D3852-042

Accept



Setup Start



Revision ID:

Stop



Item Name: Rib Assembly

Start Date: 6/13/2011 Start Qty: 2.00



Cust Item ID:

Required Date: 6/20/2011 Req'd Qty: 2.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

11/7/11 JJ

ME
11-07-06

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 13, 2011 3:24:45 PM

Page 1

Work Order ID: 70723

Parent Item: D3852-042

Parent Item Name: Rib Assembly

Start Date: 6/13/2011

Required Date: 6/20/2011

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP Rev:A 08-12-02 new issue DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D3166-3 Basket Hoop		Manufactured	No			100	Each	4.0201	0.18	0.378947	1.137		
------------------------	--	--------------	----	--	--	-----	------	--------	------	----------	-------	--	--

Handwritten notes: *Handwritten: 71304TS0.7504065, B116267 (See w/669843)*

Location	Loc Qty	Loc Code
WA007	4.02010527	
64928	0.02010527	
68442	4	

Handwritten notes: *Handwritten: M116763 => 1.137*

D3759-1 Bushing		Manufactured	No			100	Each	311.0000	1	2			
--------------------	--	--------------	----	--	--	-----	------	----------	---	---	--	--	--

Location	Loc Qty	Loc Code
WA	200	
69202	200	
WA005	111	
66489	2	
66870	109	

Handwritten notes: *Handwritten: 6*

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

ITEM	QTY -041	QTY -042	P/N	DESCRIPTION
1	X		D3852-041	RIB ASSEMBLY
2		X	D3852-042	RIB ASSEMBLY
3	1	1	D3759-1	BUSHING
4	1		D3852-1	RIB
5		1	D3852-2	RIB

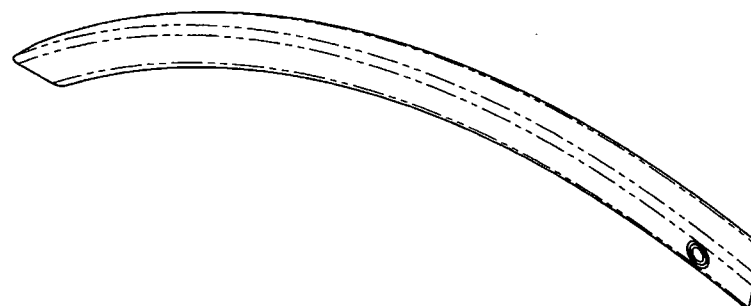

D3852-041 RIB ASSEMBLY

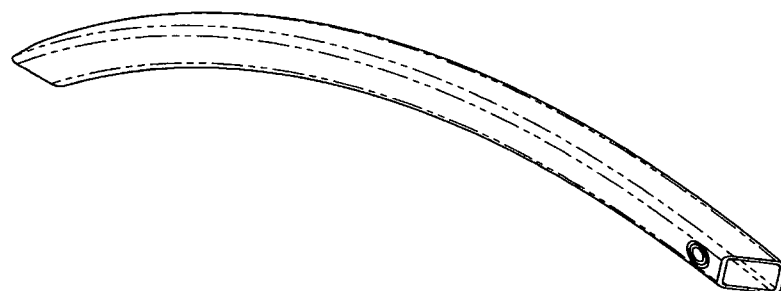

D3852-042 RIB ASSEMBLY

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 70723
11-06-13

RELEASE
08/11/13 MP

- NOTES:
1) MATERIAL: N/A
2) FINISH: NONE
3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
4) UNITS: INCHES UNLESS OTHERWISE NOTED
5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
6) IDENTIFICATION: N/A
7) WEIGHT: 0.83 lbs EACH
8) WELDING: PER QSI 004

A	NEW ISSUE	MB	08.11.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.11.07		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA
DRAWING NO. **D3852**
REV. A
SHEET 1 OF 3
TITLE **RIB ASSEMBLY**
SCALE
NTS

COPYRIGHT © 2008 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

8 7 6 5 4 3 2 1



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

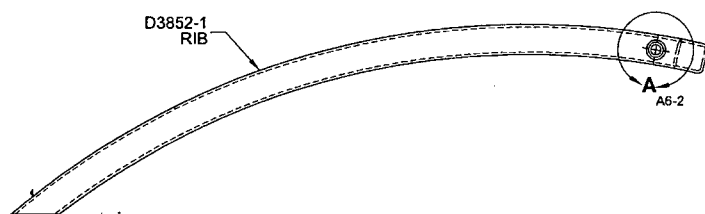


D3852-041 RIB ASSEMBLY

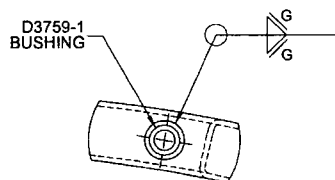

DETAIL A
SCALE 2X C5-2

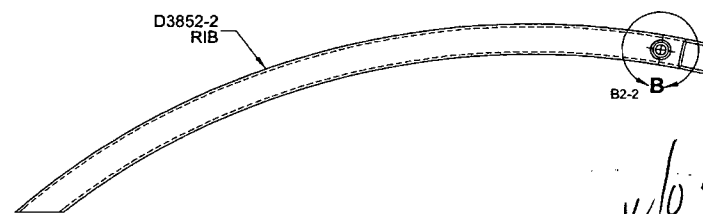

D3852-042 RIB ASSEMBLY

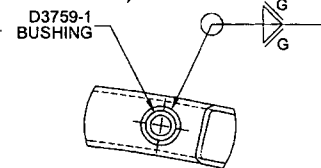

DETAIL B
SCALE 2X C2-2

RELEASED
[Handwritten signature]

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. A
MFG. APPR.	<i>[Signature]</i>	D3852	SHEET 2 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	RIB ASSEMBLY	NTS
DATE	08.11.07	<small>COPYRIGHT © 2008 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

w/070723

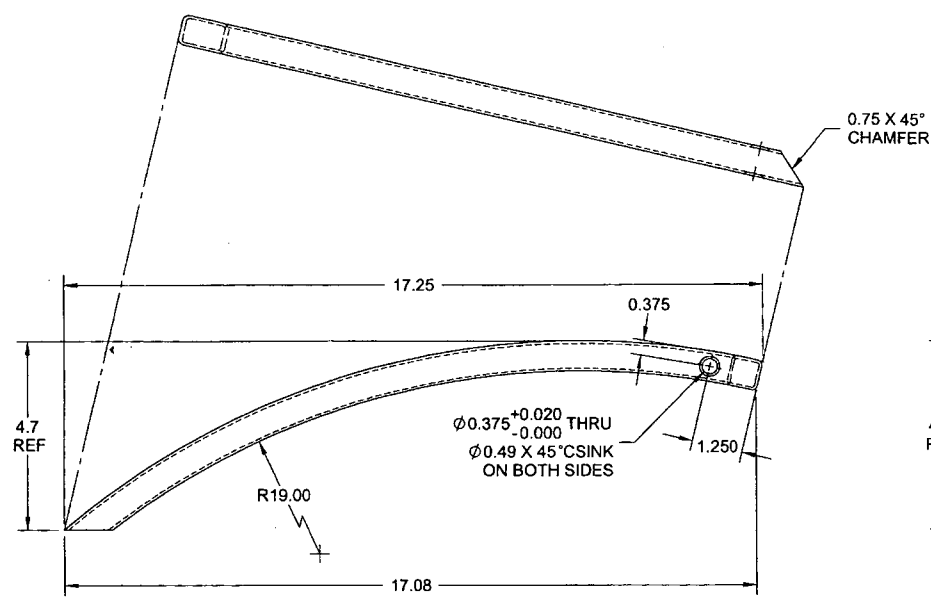

D3852-1 RIB

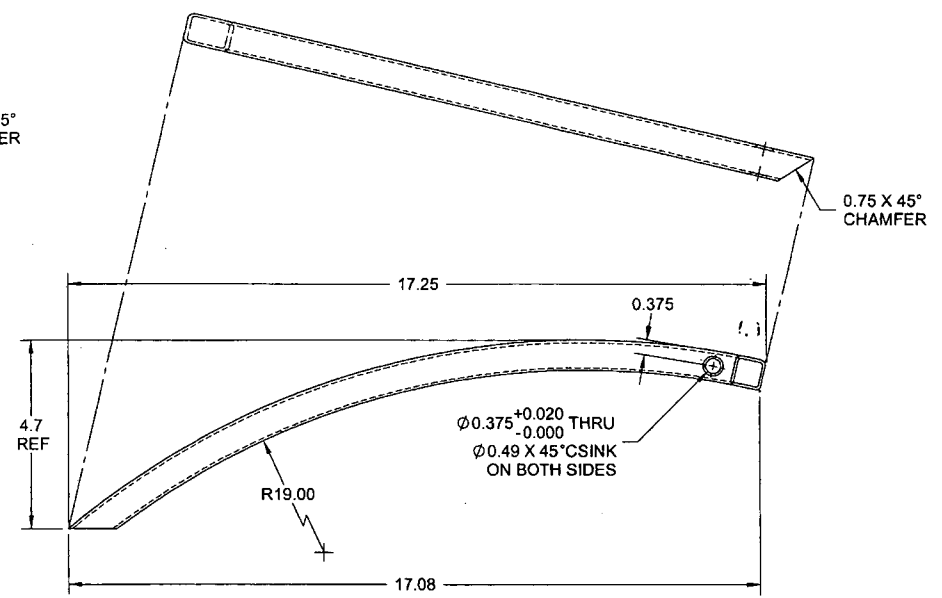

D3852-2 RIB

RELEASED
08/11/07

- NOTES:**
- 1) MATERIAL: AISI 304/316 STAINLESS STEEL SQUARE TUBE, 0.75 X 0.75 X 0.065 WALL
REF. DART SPEC. M304TS0.750W0.065
 - 2) FINISH: NONE
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: N/A
 - 7) WEIGHT: 0.82 lbs EACH

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. A
MFG. APPR.	<i>[Signature]</i>	D3852	SHEET 3 OF 3
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	RIB ASSEMBLY	NTS
DATE	08.11.07	<small>COPYRIGHT © 2008 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMING OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries